


LS型

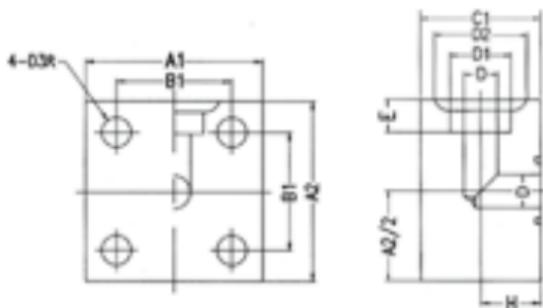

LSA

単位:mm

| 呼び径(A) | 呼び径(B) | A | A ₁ | A ₂ | B | B ₁ | C | C ₁ | D | D ₁ | D ₂ | D ₃ | E | H | 0リング | ボルト |
|--------|--------|-----|----------------|----------------|-----|----------------|----|----------------|------|----------------|----------------|----------------|----|------|------|-----|
| 10 | 3/8 | 63 | 54 | 63 | 40 | 36 | 22 | 40 | 11 | 17.8 | 28 | 11 | 9 | 20 | G25 | M10 |
| 15 | 1/2 | 63 | 54 | 63 | 40 | 36 | 22 | 40 | 16 | 22.2 | 32 | 11 | 11 | 20 | G25 | M10 |
| 20 | 3/4 | 68 | 58 | 70 | 45 | 40 | 22 | 45 | 20 | 27.7 | 38 | 11 | 12 | 22.5 | G30 | M10 |
| 25 | 1 | 80 | 68 | 82 | 53 | 48 | 28 | 50 | 25 | 34.5 | 45 | 13 | 14 | 25 | G35 | M12 |
| 32 | 1 1/4 | 90 | 76 | 92 | 63 | 56 | 28 | 63 | 31.5 | 43.2 | 56 | 13 | 16 | 31.5 | G40 | M12 |
| 40 | 1 1/2 | 100 | 92 | 110 | 70 | 65 | 36 | 71 | 37.5 | 49.1 | 63 | 18 | 18 | 35.5 | G50 | M16 |
| 50 | 2 | 112 | 100 | 125 | 80 | 73 | 36 | 85 | 47.5 | 61.1 | 75 | 18 | 20 | 42.5 | G60 | M16 |
| 65 | 2 1/2 | 140 | 128 | 150 | 100 | 92 | 45 | 106 | 60 | 77.1 | 95 | 22 | 22 | 53 | G75 | M20 |
| 80 | 3 | 155 | 140 | 170 | 112 | 103 | 45 | 118 | 71 | 90 | 108 | 24 | 25 | 59 | G85 | M22 |

※Oリングは JIS B 2401